



4S4BSAAC5H3399222

Vehicle details

Operator	. Lorna Haycraft	Inspection condition	sufficient
License number	WUXXXXX	Mileage (Read)	206,850 km
Manufacturer	Subaru	Next maintenance in	9 Monat(e)
Type / Model	OUTBACK	Main inspection (Report not on hand)	10/2026
Vehicle Identification number	4S4BSAAC5H3399222	Power	130 kW
Engine displacement	0 ccm	Cylinder	4
First registration	1 Jan 2017	Upholstery/Colour	Cloth / Beige
Last maintenance	04/2026, 204,145 km	Paintwork	Blue
Fuel type	Petrol	Gearbox	Automatic (Automatik)

Hereinnahmebewertung

Value reducing factors

No.	Component group	Description	Costs (Net)
1	Mudguard - right side	Mudguard - right side - dent(s) - Smooth repair work	90,00 €
2	Door - front left side	Door - dent(s) - Smooth repair work	130,00 €
3	Wing mirror - right side	Wing mirror - Scratched - Replace	150,00 €
4	Instrument panel	Indicator light (Reifen, vorbehaltlich Folgekosten) - on - Diagnosed and repair if necessary	250,00 €
5	Engine	Engine (Vorbehaltlich Folgekosten) - Leaking - Diagnosed and repair if necessary	250,00 €
6	Boot lid / rear door	Boot lid - Scratch(es) - Repair and paint	450,00 €
7	Roof	Roof (Vorbehaltlich Folgekosten) - dent(s) - Smooth repair work	500,00 €
8	Door - front right side	Door - Dent / paintcoat damage - Repair and paint	500,00 €
9	Door - rear left side	Door - Dent / paintcoat damage - Repair and paint	500,00 €
10	Side panel - rear right side	Side panel - Dent / paintcoat damage - Repair and paint	600,00 €
11	Rear bumper	Rear bumper - Scratch(es) - Repair and paint	650,00 €
12	Door - rear right side	Door - Damaged - Repair and paint	1.000,00 €

Wear and tear

No.	Component group	Description	Costs (Net)
The vehicle shows traces of wear and tear corresponding to its age and purpose			

Missing parts

Missing part	Costs (Net)
Interior - Boot cover / roller cover	200,00 €

TÜV SÜD Auto Service GmbH
Louis-Pasteur-Str.13
97076 Würzburg

Inspection location
Bavarian Motor Cars GmbH
Louis-Pasteur-Str. 14
97076 Würzburg

Inspection date: 22 Jul 2026
Protocol number: 46635424
Created by: Marcel Cohen
Inspected by: M. Cohen



Detected repainting

No.	Location	Loss in value
1	Door - rear left side, Professionally carried out, Invoice of repair done Non-existent	100,00 €

Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/65 R17 106V	Uniroyal	All-season tyres	7mm - 7mm	o.k.	Not o.k.
2	225/65 R17 106V	Uniroyal	All-season tyres	8mm - 8mm	o.k.	Not o.k.

Replacement

Type	Tyre size	Manufacturer	Type of tyre	Tread depth	Expiration date
Space saver spare wheel	155/80 R17 101M	Maxxis	Summer tires (with run-flat tires)	4	

The wear and tear condition and possible damages to the tyres are considered in the value.

Equipment

Equipment: Automatic air conditioning, No navigation unit, Radio with SD/USB interface

Comments

Vorbehaltlich Fehlerspeicher auslesen

Keine vollständige Rep. Historie und Ausstattungsliste vorhanden, vorbehaltlich Folgekosten

Aufgrund umfangreicher Elektroniksysteme, konnte nur stichpunktartige Überprüfungen durchgeführt werden. Eventuelle Schäden oder Fehlfunktionen an nicht geprüften Systemen können dadurch nicht ausgeschlossen werden. Vorbehaltlich Folgekosten.



Vehicle details

Manufacturer	Subaru	Inspection condition	sufficient
Type / Model	OUTBACK	Mileage (Read)	206,850 km
Vehicle Identification number	4S4BSAAC5H3399222	First registration	1 Jan 2017

Summary of damage

Damage category	Rep.costs	
Damages	5.070,00 €	
Wear and tear	0,00 €	
Missing parts	200,00 €	
Total amount (without VAT)	5.270,00 €	
VAT (19%)	1.001,30 €	
Total amount (incl. VAT)	6.271,30 €	
Depreciation due to repainting (not included in the costs) is tax-neutral		100,00 €

Paint coat thickness

No.	Location	Measurement
1	Roof	126 µm
2	Roof rail - left side	110 µm
3	Roof rail - right side	93 µm
4	Mudguard - left side	135 µm
5	Mudguard - right side	107 µm
6	Bonnet	124 µm
7	Sill - left side	51 µm
8	Sill - right side	39 µm
9	Side panel - rear left side	106 µm
10	Side panel - rear right side	103 µm
11	Door - rear left side	189 µm
12	Door - rear right side	115 µm
13	Door - front left side	100 µm
14	Door - front right side	119 µm

Details of the order:

In accordance with the contract, the evaluation of vehicle's condition was performed without the vehicle being disassembled.

This product is based on the guidelines for vehicle returns and assessments according to the client's damage limit catalog. The expert makes the explicit findings in each individual case objectively, within the framework of the specified standards, based on their own expertise.

Vehicle identification:

The vehicle identification number (VIN) was simply read from the vehicle. The undersigned had no documentation for verification.

Inspection conditions:

The inspection conditions were sufficient for the assessment of the vehicle.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

TÜV SÜD Auto Service GmbH
Louis-Pasteur-Str.13
97076 Würzburg

Inspection location
Bavarian Motor Cars GmbH
Louis-Pasteur-Str. 14
97076 Würzburg

Inspection date: 22 Jul 2026
Protocol number: **46635424**
Created by: Marcel Cohen
Inspected by: M. Cohen



A handwritten signature in blue ink, consisting of the letters 'M.' followed by a stylized, cursive 'C'.

Expert's signature (Marcel Cohen)

The current printed copy was produced by electronic means. The named technical expert states that the content correctly represents his or her findings. It is valid without an original signature.

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior

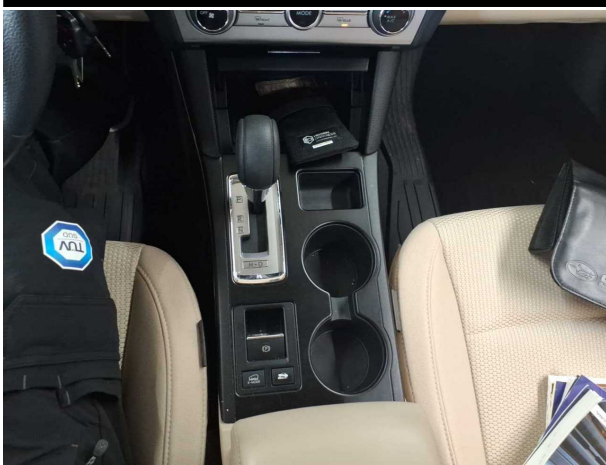


Figure 7: Interior



Figure 8: Interior



Figure 9: Interior

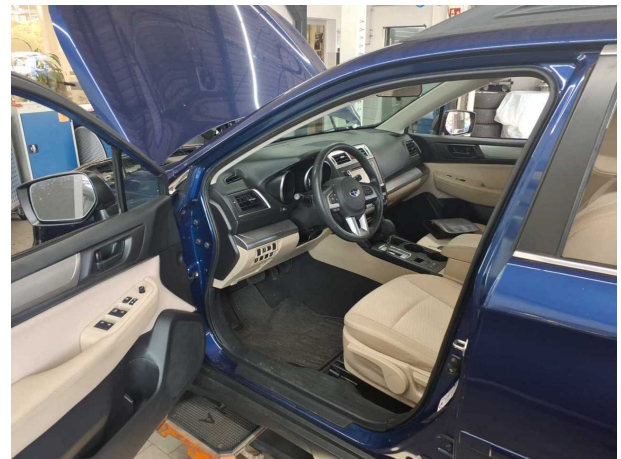


Figure 10: Interior



Figure 11: Interior



Figure 12: Interior



Figure 13: Interior

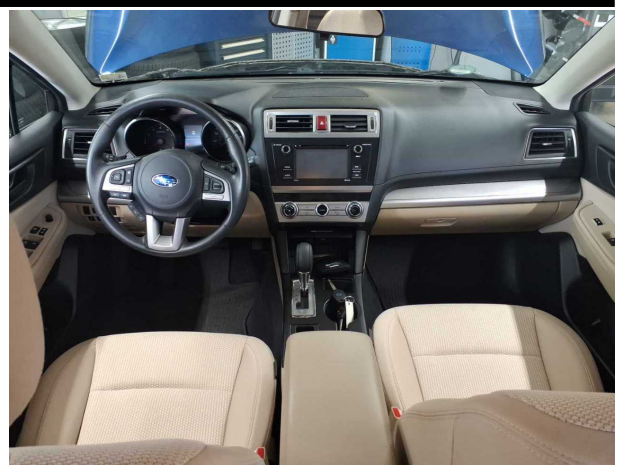


Figure 14: Interior



Figure 15: Interior



Figure 16: Interior



Figure 17: Interior



Figure 18: Interior

TÜV SÜD Auto Service GmbH
Louis-Pasteur-Str.13
97076 Würzburg

Inspection location
Bavarian Motor Cars GmbH
Louis-Pasteur-Str. 14
97076 Würzburg

Inspection date: 22 Jul 2026
Protocol number: 46635424
Created by: Marcel Cohen
Inspected by: M. Cohen

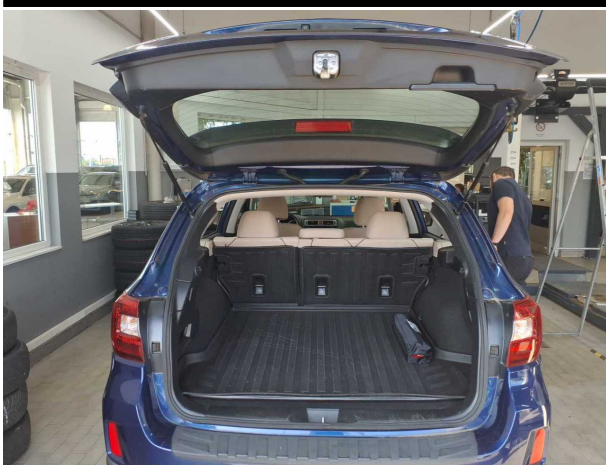


Figure 19: Interior

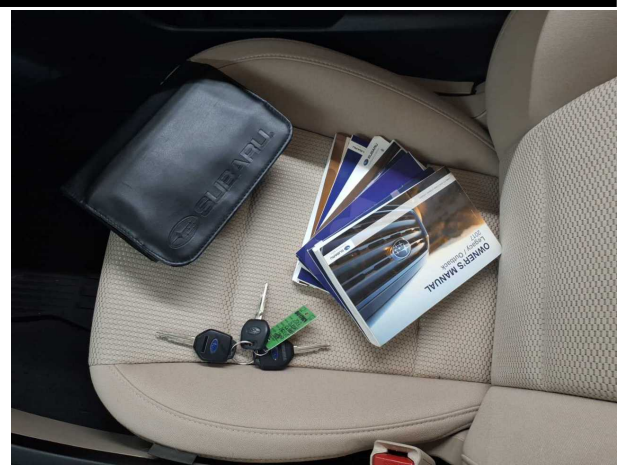


Figure 20: Misc.

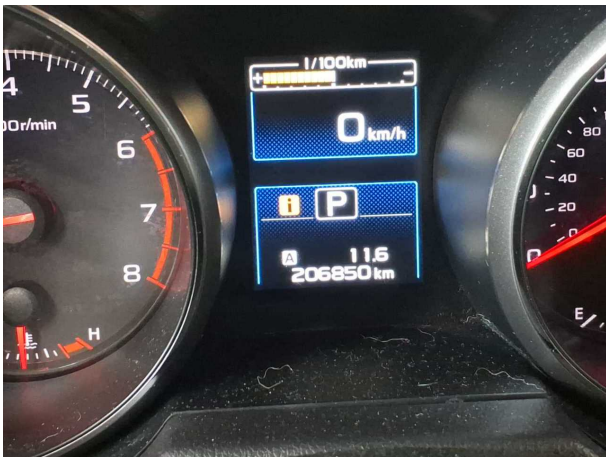


Figure 21: Misc.

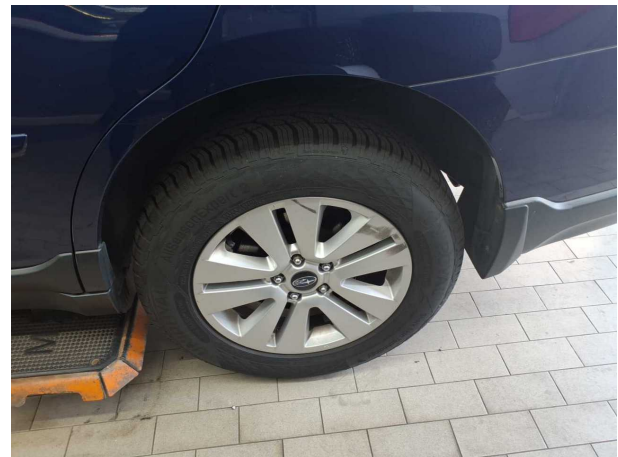


Figure 22: Misc.



Figure 23: Misc.

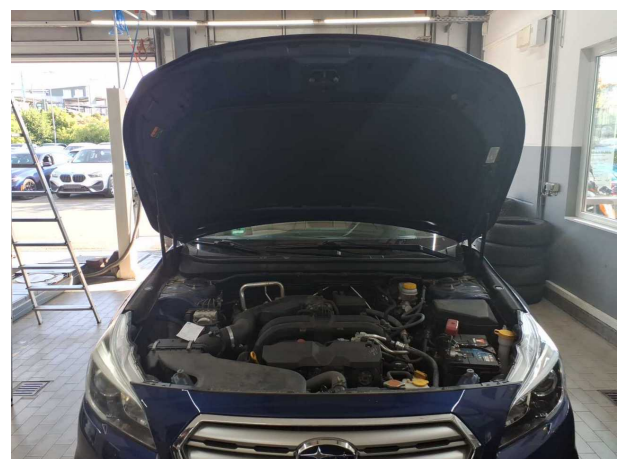


Figure 24: Misc.

TÜV SÜD Auto Service GmbH
 Louis-Pasteur-Str.13
 97076 Würzburg

Inspection location
 Bavarian Motor Cars GmbH
 Louis-Pasteur-Str. 14
 97076 Würzburg

Inspection date: 22 Jul 2026
Protocol number: 46635424
 Created by: Marcel Cohen
 Inspected by: M. Cohen



Figure 25: Misc.

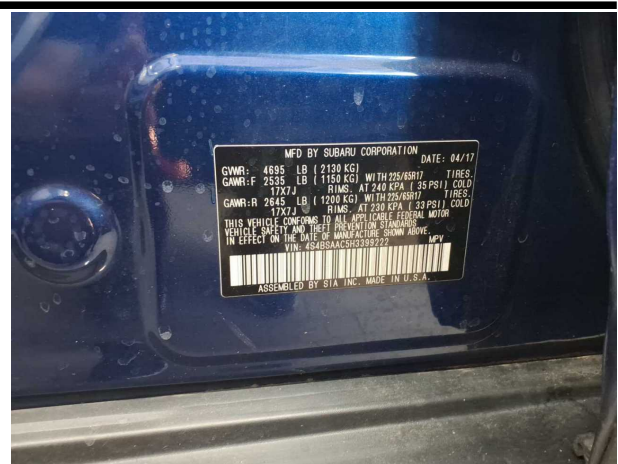


Figure 26: Misc.

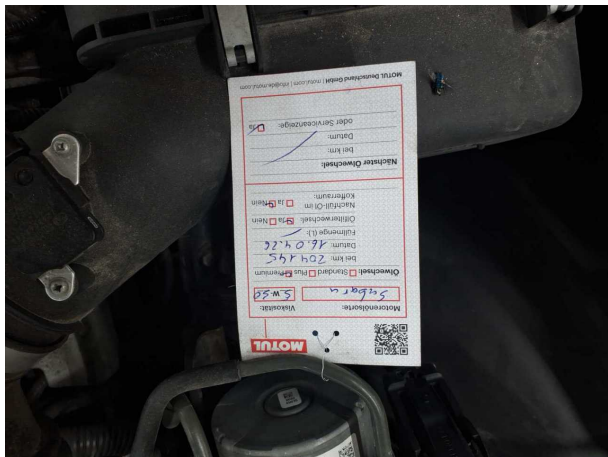


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.

TÜV SÜD Auto Service GmbH
Louis-Pasteur-Str.13
97076 Würzburg

Inspection location
Bavarian Motor Cars GmbH
Louis-Pasteur-Str. 14
97076 Würzburg

Inspection date: 22 Jul 2026
Protocol number: 46635424
Created by: Marcel Cohen
Inspected by: M. Cohen



Figure 31: Misc.

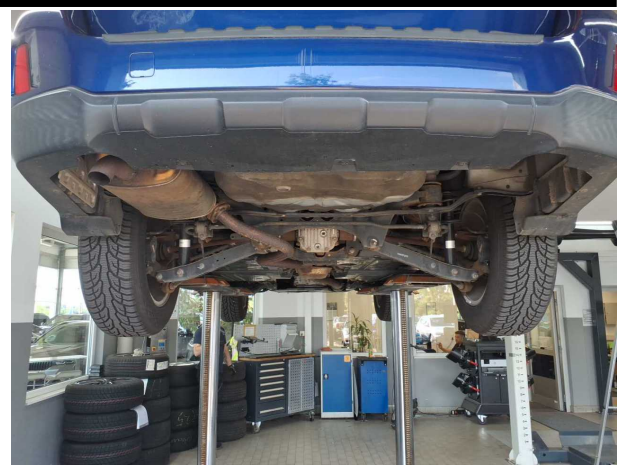


Figure 32: Misc.


Pictures of damage



Damage #1: Mudguard - right side: Mudguard - right side - dent(s) - Smooth repair work



Damage #1: Mudguard - right side: Mudguard - right side - dent(s) - Smooth repair work

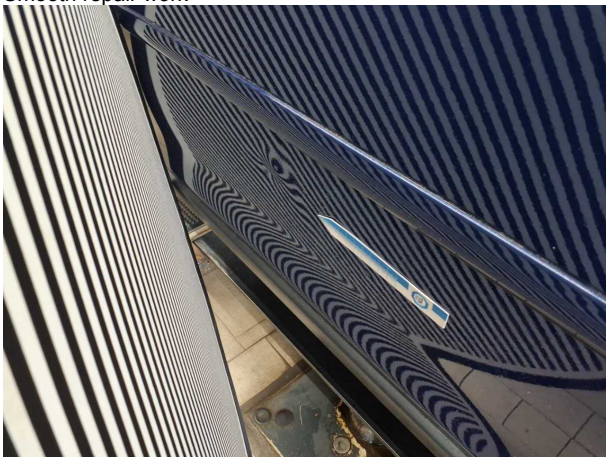

Damage #2: Door - front left side: Door - dent(s) - Smooth repair work



Damage #2: Door - front left side: Door - dent(s) - Smooth repair work



Damage #2: Door - front left side: Door - dent(s) - Smooth repair work



Damage #3: Wing mirror - right side: Wing mirror - Scratched - Replace



Damage #3: Wing mirror - right side: Wing mirror - Scratched - Replace




Damage #4: Instrument panel: Indicator light (Reifen, vorbehaltlich Folgekosten) - on - Diagnosed and repair if




Damage #5: Engine: Engine (Vorbehaltlich Folgekosten) - Leaking... Diagnosed and repair if necessary



Damage #6: Boot lid / rear door: Boot lid - Scratch(es) - Repair and paint

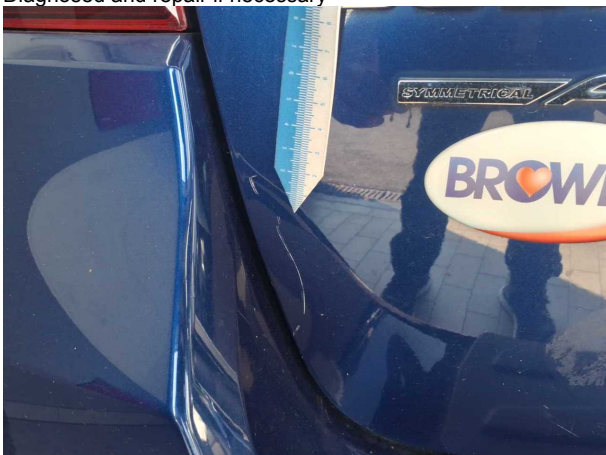

Damage #6: Boot lid / rear door: Boot lid - Scratch(es) - Repair and paint

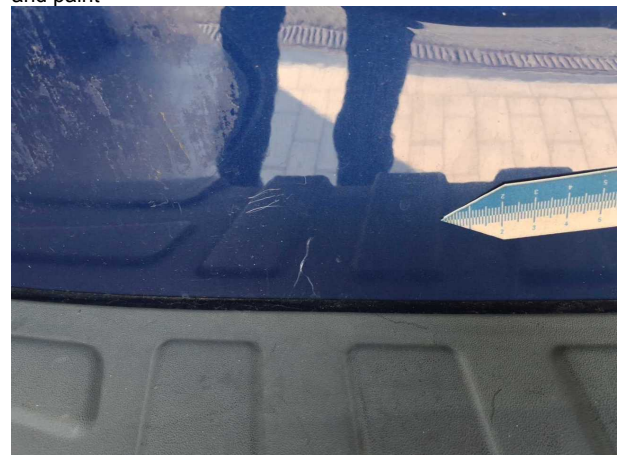

Damage #6: Boot lid / rear door: Boot lid - Scratch(es) - Repair and paint




Damage #7: Roof: Roof (Vorbehaltlich Folgekosten) - dent(s) - Smooth repair work



Damage #7: Roof: Roof (Vorbehaltlich Folgekosten) - dent(s) - Smooth repair work




Damage #8: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

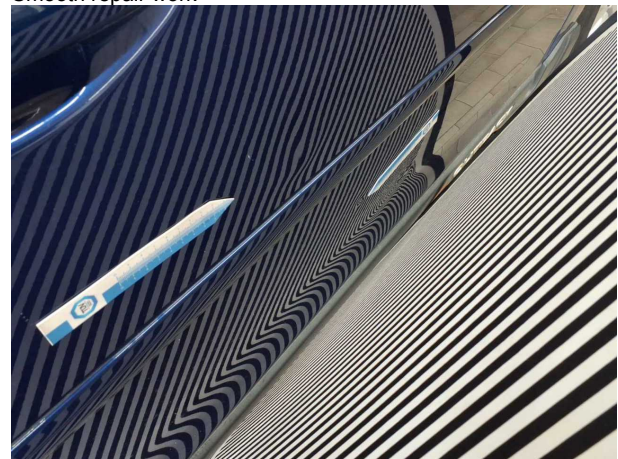


Damage #8: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage #8: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

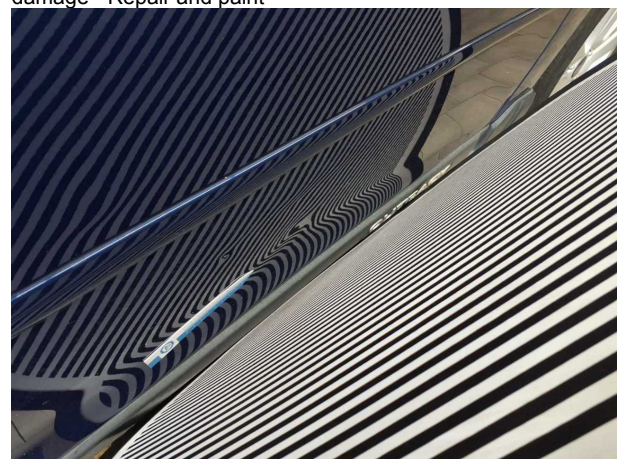


Damage #8: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

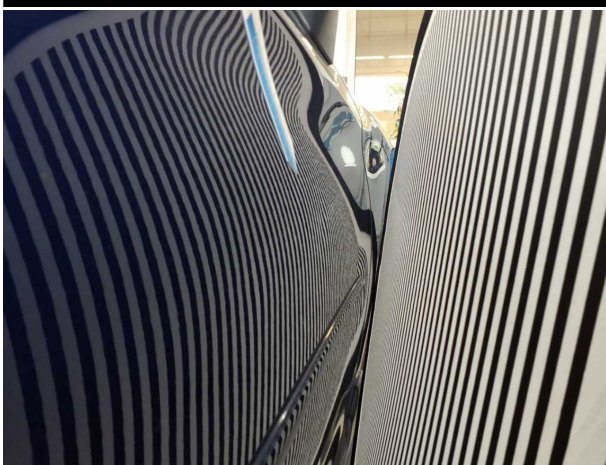

Damage #8: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage #9: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

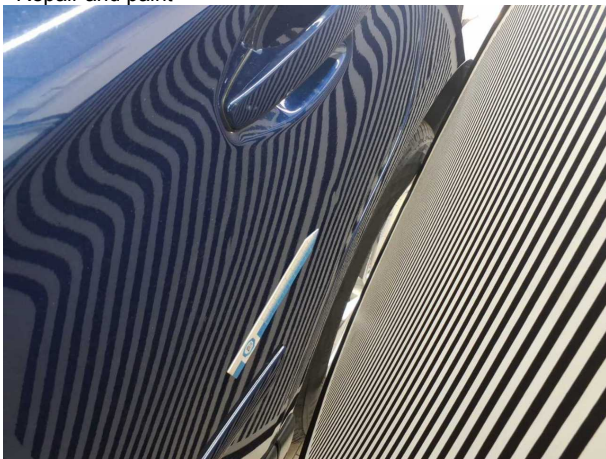


Damage #9: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint




Damage #9: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage #10: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

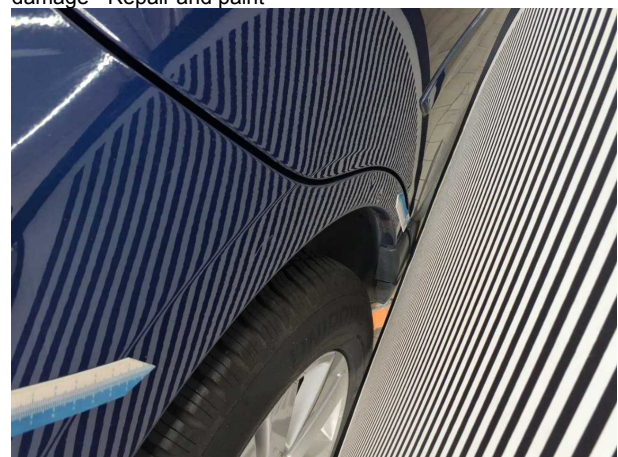

Damage #10: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

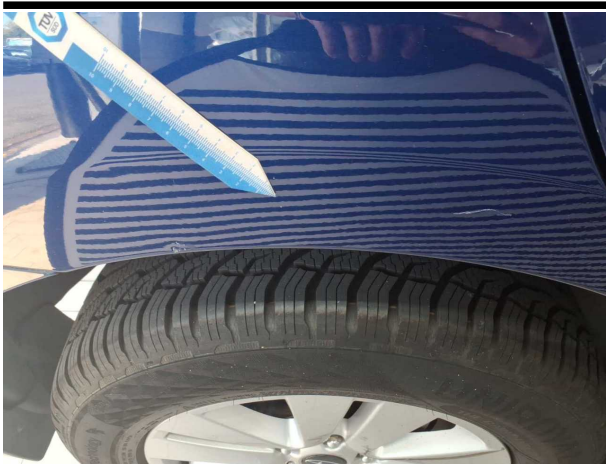

Damage #10: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



Damage #10: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint




Damage #11: Rear bumper: Rear bumper - Scratch(es) - Repair and paint



Damage #11: Rear bumper: Rear bumper - Scratch(es) - Repair and paint




Damage #11: Rear bumper: Rear bumper - Scratch(es) - Repair and paint

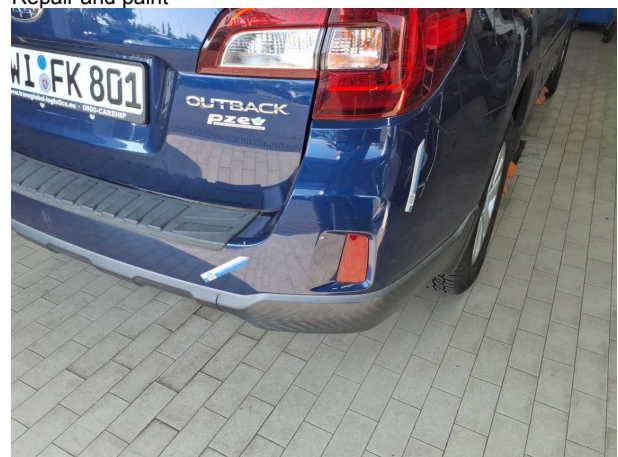

Damage #11: Rear bumper: Rear bumper - Scratch(es) - Repair and paint




Damage #11: Rear bumper: Rear bumper - Scratch(es) - Repair and paint

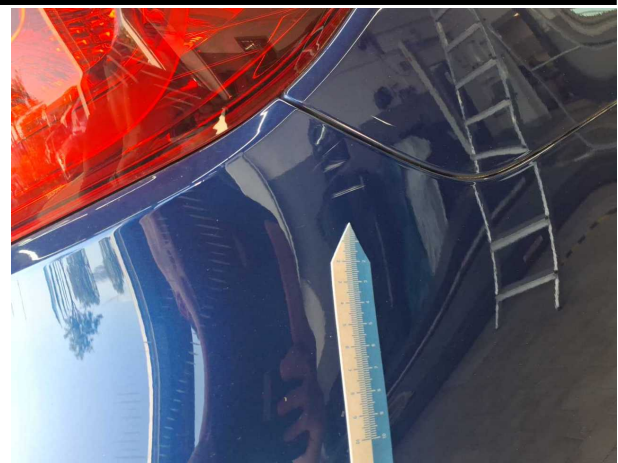


Damage #11: Rear bumper: Rear bumper - Scratch(es) - Repair and paint



Damage #12: Door - rear right side: Door - Damaged - Repair and paint

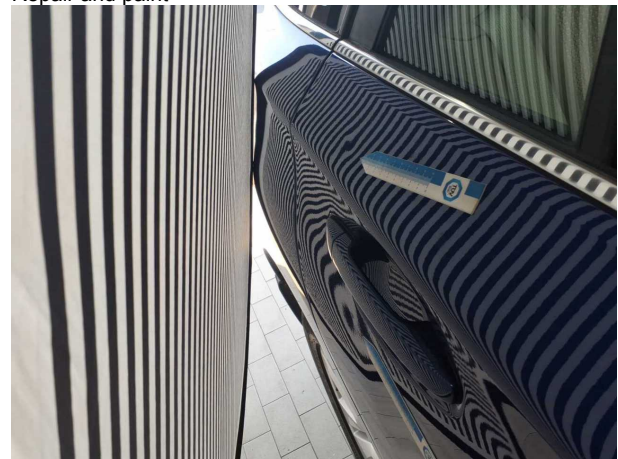

Damage #12: Door - rear right side: Door - Damaged - Repair and paint

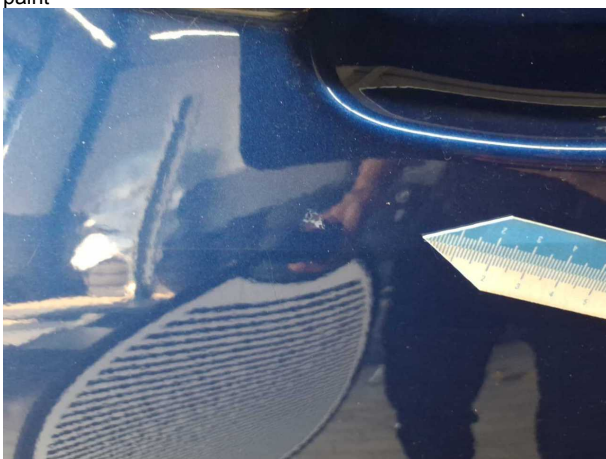

Damage #12: Door - rear right side: Door - Damaged - Repair and paint




Damage #12: Door - rear right side: Door - Damaged - Repair and paint


TÜV SÜD Auto Service GmbH
Louis-Pasteur-Str.13
97076 Würzburg

Inspection location
Bavarian Motor Cars GmbH
Louis-Pasteur-Str. 14
97076 Würzburg

Inspection date: 22 Jul 2026
Protocol number: 46635424
Created by: Marcel Cohen
Inspected by: M. Cohen

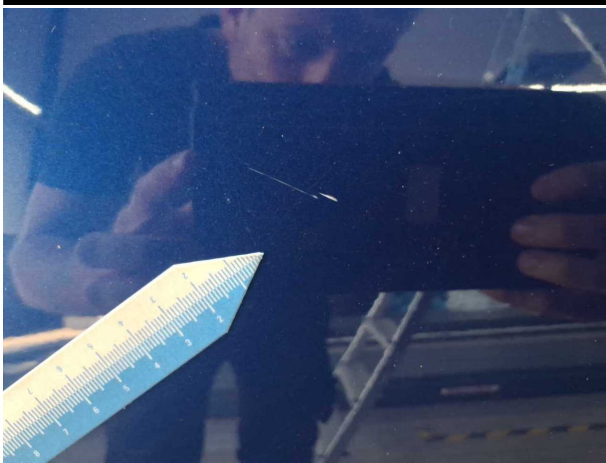


Damage #12: Door - rear right side: Door - Damaged - Repair and paint

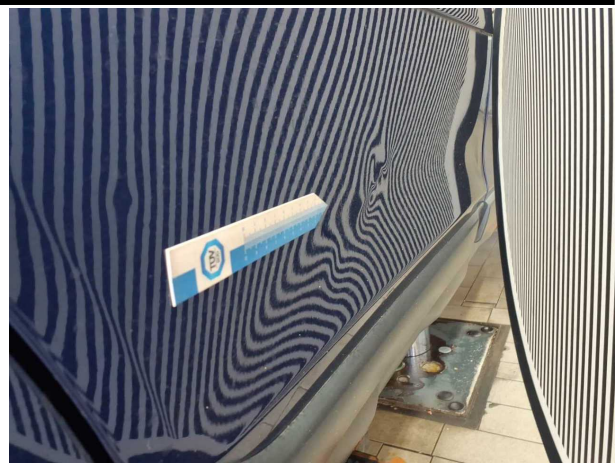

Damage #12: Door - rear right side: Door - Damaged - Repair and paint



Damage #12: Door - rear right side: Door - Damaged - Repair and paint

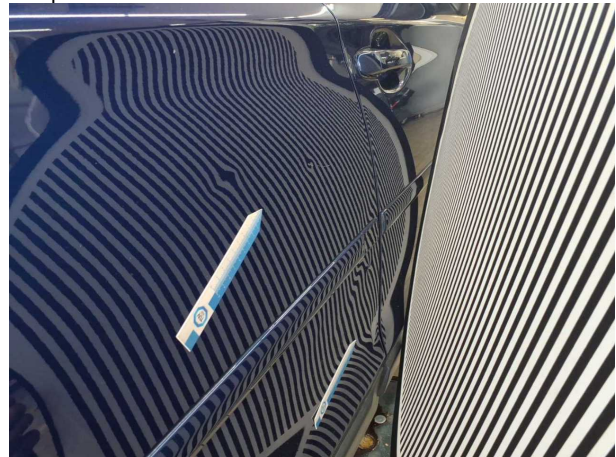

Damage #12: Door - rear right side: Door - Damaged - Repair and paint