

» Overview

Order number: 1001931670
Order completed: 04.08.2025 12:08
Report number: 8812656
VIN: WVVZZZE1ZNP009419



Front Left 3/4



Rear Right 3/4



Mileage

» Vehicle Data

Vehicle category:	Passenger Car
Vehicle type:	Compact car
Make:	Volkswagen
Model:	ID 3
Manufacturers and type code:	0603 / CKU
Date of first registration:	28.06.2022
Mileage:	54,152 km
Proof of mileage:	
Exterior colour:	Platinum Grey - Dusty Grey Dark/ Noir Soul - Dusty Grey Dark/Noir/Noir
Roof colour:	Noir
Propulsion:	Back
Fuel:	Electric
Engine size (cc):	
Performance:	150 kW (205 PS)
Length:	4,261 mm
Height:	1,568 mm
Width:	1,809 mm
Permitted total weight:	2,260 kg
Wheelbase:	2,770 mm
Number of powered axles:	2
Cylinders:	
Euronorm:	
Number of doors:	5
Number of seats:	5
Gearbox:	Automatic 1-speed
Upholstery type:	Lining fabrics
Interior colour:	Turquoise Makena Métallisé
Number of keys:	2

» Documents & Maintenance

Statutory inspection date:	
Registration certificate available:	Yes
Registration certificate received:	Yes
License plate:	None
Maintenance book:	Digital
Maintenance:	Not testable
Maintenance last date:	
Maintenance last mileage:	
Remainder until next maintenance:	310

"East Derry" 7.5J x 18, Black, diamond-turned, tires 215/55 R18

"Style" interior with Black steering wheel

11 kW AC charging power (alternating current)

2 USB-C ports in the front, 2 USB-C charging sockets on the center console in the rear

3 rear seats, asymmetric split folding rear seat backrest, w/ center armrest, load-through hatch, 2 beverage holders

30-color ambient lighting

3-point seat belts in front with seat belt pretensioners

4 alloy wheels "East Derry" 7.5J x 18, Black, diamond-turned surface

4+1 speakers

Ability for online updates starting with ID. software version 2.1

Adaptive Cruise Control ACC stop & go incl. speed limiter

Air conditioning system Climatronic with enhanced air filter with activated carbon and stationary air conditioning

App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto

Armrest for front seats

Auto. Emergency Braking Front Assist with Pedestrian and Cyclist Monitoring

Auto-dimming interior rearview mirror

Automatically-heated washer nozzles in front

Battery 320 A (49 Ah)

Bezel for infotainment display and central controls in Black

Car2X

Carpet mats in front and rear

CCS vehicle inlet

Cell module A

Center console with illuminated storage compartment with sliding cover, 2 beverage holders

Charging cable M2 EU angled safety plug (Schuko) 8A

Charging cable mode 3 type 2, 32 A

Comfort package

Curtain airbags in front and rear, side airbags in front, center airbag

DC-DC converter 3.0 kW

Digital radio reception DAB+

Disc brakes in front

Diversity antenna for FM reception

Door and side trim panel in foam film, insert in leatherette

Driver alert system

Driver and front passenger airbag with front passenger airbag deactivation

Driving Mode Selection

Driving on the right

Drum brakes in rear

Dynamic Road Sign Display

eCall Emergency System

Electric auxiliary air heater

Electric motor unit 0EH.A

Electric motor, total system output 107 kW base motor is N06

Electromechanical speed-sensitive power steering

Electronic engine sound

Electronic immobilizer

Elimination of nameplate for engine designation on luggage compartment lid

Equipment options subset for France

Exterior mirror housings

Exterior mirrors, power-adjustable, folding and heated, w/ front passenger exterior mirror lowering function

Exterior mirrors: aspherical on driver side, convex on front passenger side

First aid kit, warning triangle and safety vest

Front seats with height adjustment

Front stabilizer bar

Gear ratio 11.530

Green heat-insulating glass windows on sides and in rear

Hatchback

Heated front seats

High-voltage battery 62 kWh (gross)

Illuminated vanity mirrors in sun visors

Infotainment package

Inserts of front seats and outer rear seats in fabric "Flow"

ISOFIX anchors for child seats on outer rear bench seats and on front passenger seat, compatible for i-Size

Keyless Start without SAFELOCK

Labels in French

Laminated safety glass windshield, heat- and sound-insulating

Lane keeping system Lane Assist

Leather-wrapped multi-function steering wheel, heated, with touch control

LED headlamps with automatic headlight control

LED rear combination lamps

Left-hand drive

License plate carrier in front and rear (ECE)

Luggage compartment floor

Manual in French (France)

Maximum DC charging power (direct current) depending on the high-voltage battery pack

Mobile phone interface "Comfort" with inductive charging feature

Navigation system "Discover Pro"

No special edition

No special purpose vehicle, standard equipment

Oncoming vehicle braking when turning and swerve support

Operating permit, alteration

Operating voltage 12 V

Park Distance Control - warning signals for obstacles in the front and rear

Part set without country-specific prescriptive standard

Pedals in stainless steel, with play and pause symbols

Platform group class 1

Pro

Radio "Ready 2 Discover"

Rain sensor

Rear axle weight, standard

Rear shock absorption, basic version 1

Rear stabilizer bar

Rear-wheel drive

Refrigerant R1234yf

Regional code " ECE " for radio

Roof trim strip in Matte Black, air intake and sill in Matte Black

Service indicator 2 years (fix) without km, electric vehicle

Shock absorption in front

Single-tone horn

Software network, version 5

Special identification label for EC for M1 passenger vehicles

Standard climatic zones

Standard curb weight range

Standard dashboard

Standard manufacturing sequence

Surround lighting with welcome light

Suspension range 02 installation control only, no requirement forecast

Tailgate/trunk lid unlocking from outside

Tire Pressure Monitoring System

Tires 215/55 R18

Tool kit and Tire Mobility Set: 12-volt compressor and tire sealant

Torque 275 Nm Base motor is N06

Transmission for electric drive (1-speed)

Transport protection film (minimum protection) with additional transport protection measures

Trims for alloy wheels

Type approval country France

UWB-capable country and carrier frequency, 433.92 to 434.42 MHz

Vehicle class differentiation -10A-

Vehicles with special upgrade measures

Voice control

Warning signal and warning light for front and rear seat belts not fastened

Weight range 5 installation control only, no requirement forecast

Wheel locks with extended theft protection

With special requirements on the steering column lock

Without additional tires

Without auxiliary heater/parking heater

Without camera systems/accident sensors

Without customized installation

Without extended safety system

Without exterior ambient lighting

Without front cross traffic assist

Without head-up display

Without lane change assist

Without light control

Without locking and starting systems

Without lumbar support in seat backrests

Without parking assistance/garage parking assist

Without preparation for VTS (vehicle tracking system)

Without roof insert (standard roof)

Without special body measures

Without specific emission standard

Without trailer hitch

» Tyres

MOUNTED TYRES

Make	Location	Position	Type	Rim	Dimensions	Profile depth
Firestone	Front	Left	Summer	Aluminium	215/55 R 18 99 V	3.0 mm
Firestone	Front	Right	Summer	Aluminium	215/55 R 18 99 V	2.4 mm
Firestone	Rear	Left	Summer	Aluminium	215/55 R 18 99 V	3.5 mm
Firestone	Rear	Right	Summer	Aluminium	215/55 R 18 99 V	2.7 mm

Permitted: Yes

Roadworthy: Yes

SPARE/EMERGENCY TYRE & ACCESSORIES

Repair kit present: Yes

Repair kit expiration date: 06.2025

Compressor present: Yes

» Devaluation Factors

Nr	Location	Damage type	Repair type
1	Bumper F	Deformed / Strained	Repair and paint (complete)
2	Door FR	Dent(s) and scratch(es)	Repair and paint (complete)
3	Bumper R	Scratch(es)	Paint
4	Preparationtime bodywork	Paint preparation	Execute
5	Wing FR	Scratch(es)	Paint
6	Alloy rim FR bitone/polychrome	Scratch(es)	Repair and paint (partial)
7	Inner door sill RL	Scratch(es)	Paint
8	Tyre FL	Out of tolerance	Replace
9	Tyre RL	Out of tolerance	Replace
10	Tyre RR	Out of tolerance	Replace
11	Tyre FR	Out of tolerance	Replace
12	Rear spoiler	Scratch(es)	Paint
13	Tyre repair kit	Expired	Replace

» Usage Damages

Nr	Location	Damage type	Repair type
1	Alloy rim FL bitone/polychrome	Scratch(es)	Acceptable
2	Alloy rim RR bitone/polychrome	Scratch(es)	Acceptable
3	Outside rear-view mirror housing L	Scratch(es)	Acceptable
4	Wing RL	Dent(s)	Acceptable
5	Bumper spoiler F	Scratch(es)	Acceptable
6	Grille	Scratch(es)	Acceptable
7	Tyres	No damage	Acceptable

» Commercial devaluation

Known previous damages:	No
Previous damages detectable:	No
Repainting present:	No
Paint thickness measurement performed:	Yes - no abnormalities/deviations

PAINTTHICKNESS MEASUREMENT RESULTS

The measured values were in the usual range.

At least 3 measurements were carried out per component.

» Notes On The Assessment

Details of the assignment and the scope of the assessment:

The order was placed to prepare a condition report on the described vehicle.

The vehicle condition assessment was carried out in accordance with the order on the basis of the standards for vehicle assessments specified by the client. The expert makes the findings in the individual case on the basis of his own expertise and at his own expert discretion.

Vehicle identification:

WVWZZZE1ZNP009419

VIN checked and matches documentation

Vehicle condition:

Average general condition

Inspection condition:

Sufficient

Colour matching:

The vehicle color no longer corresponds to the delivery condition.

Lifting platform/lifting equipment used:

No

Testdrive carried out:

No

Engine test carried out:

Yes

» Remarks

This copy was generated electronically. It is valid without an original signature.

» Commercial Pictures


Front Left 3/4



Front Right 3/4




Rear Left 3/4




Rear Right 3/4



Mileage

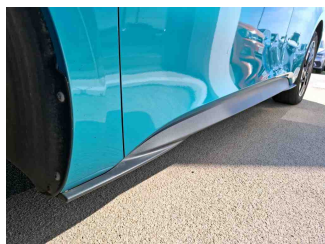


Sill outer L

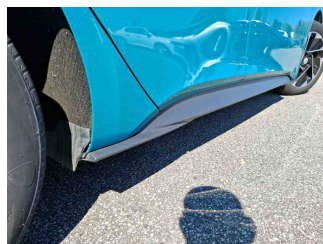


Sill outer R




Chassis nr

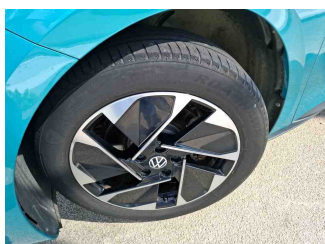


Wheel FL

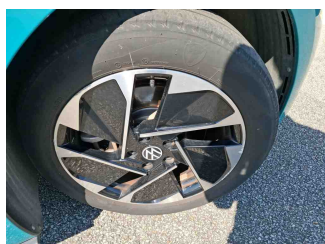

Wheel FR

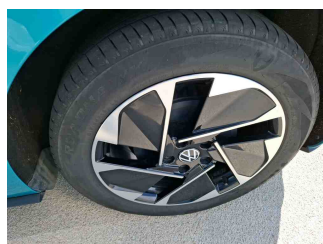

Wheel RL

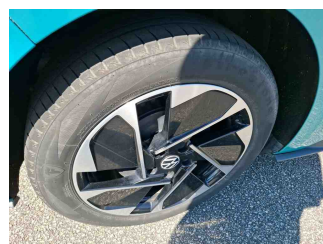

Wheel RR




Spare wheel




Central console




Engine compartment

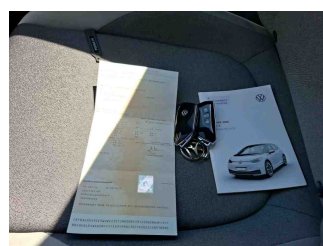


Documents

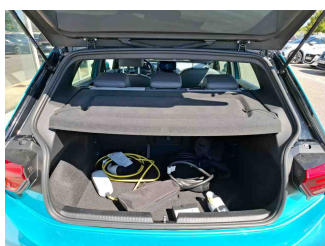


Interior arrangement

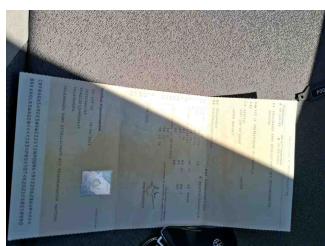


Registration Certificate

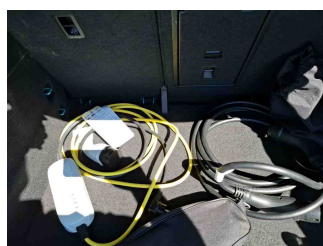

Charging cable (normal)

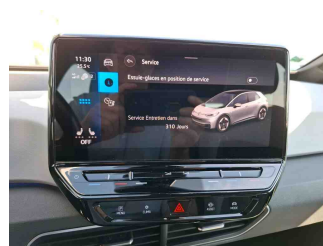

History Maintenance

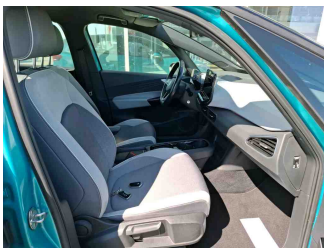

Interior - front



Interior - rear



Tirefit expiration date



GPS/Radio


» Devaluation Damages

DEVALUATION FACTORS



1 - Bumper F - Deformed / Strained - Repair and paint (complete)



2 - Door FR - Dent(s) and scratch(es) - Repair and paint (complete)

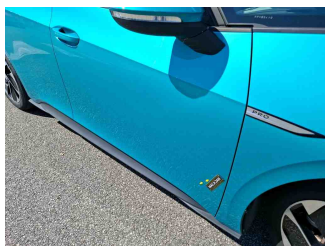


3 - Bumper R - Scratch(es) - Paint


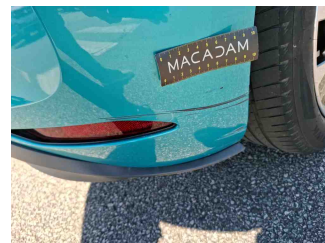
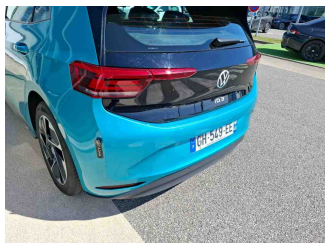


4 - Preparationtime bodywork - Paint preparation - Execute

5 - Wing FR - Scratch(es) - Paint

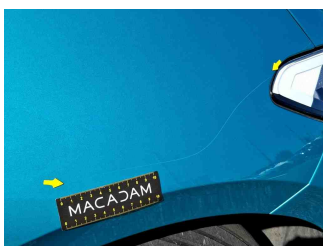



6 - Alloy rim FR bitone/polychrome - Scratch(es) - Repair and paint (partial)

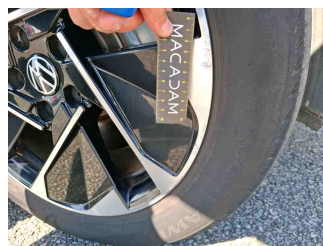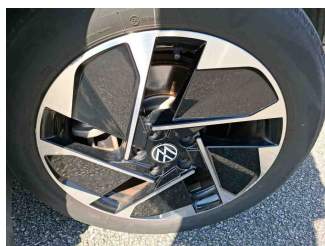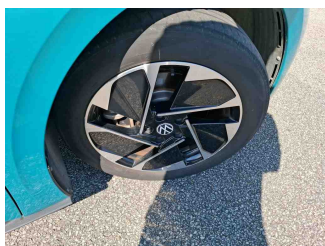



7 - Inner door sill RL - Scratch(es) - Paint





8 - Tyre FL - Out of tolerance - Replace

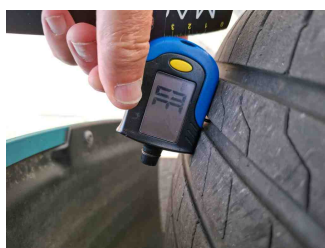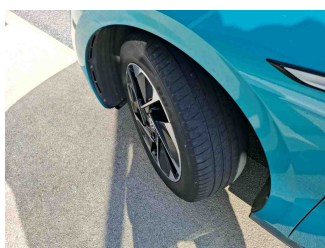


9 - Tyre RL - Out of tolerance - Replace

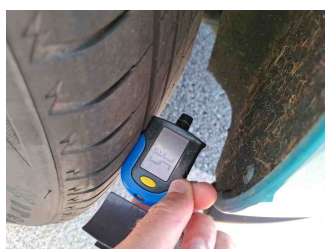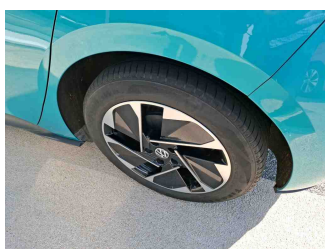

10 - Tyre RR - Out of tolerance - Replace

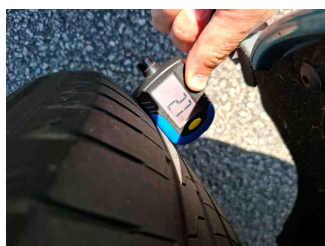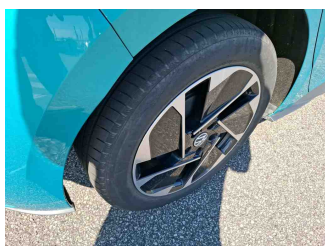

11 - Tyre FR - Out of tolerance - Replace

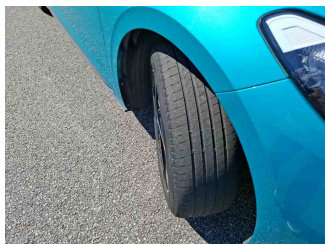




12 - Rear spoiler - Scratch(es) - Paint






13 - Tyre repair kit - Expired - Replace


USAGE DAMAGES


1 - Alloy rim FL bitone/polychrome - Scratch(es) - Acceptable

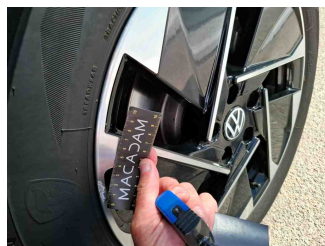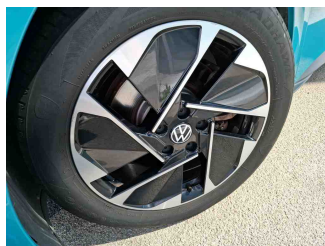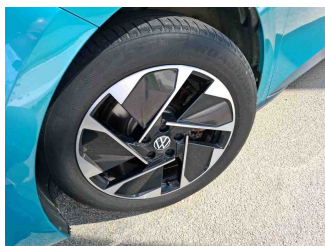


2 - Alloy rim RR bitone/polychrome - Scratch(es) - Acceptable

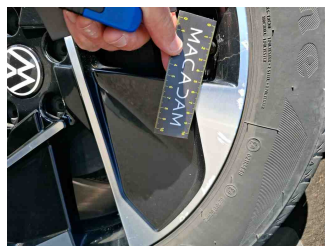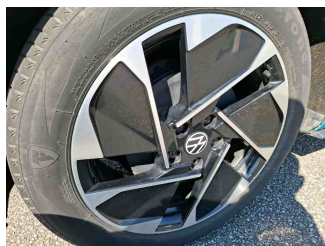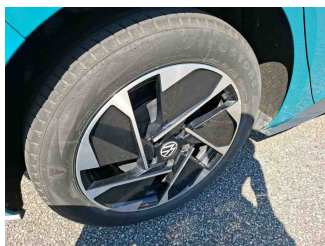


3 - Outside rear-view mirror housing L - Scratch(es) - Acceptable

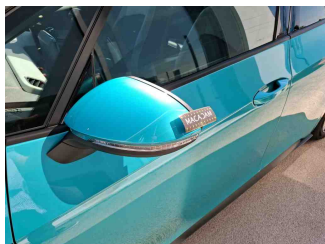


4 - Wing RL - Dent(s) - Acceptable

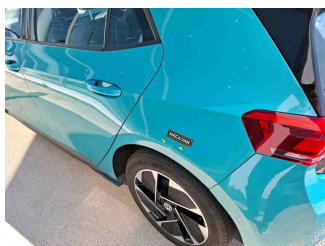

5 - Bumper spoiler F - Scratch(es) - Acceptable

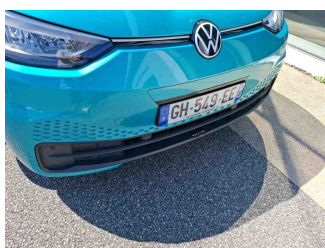

6 - Grille - Scratch(es) - Acceptable

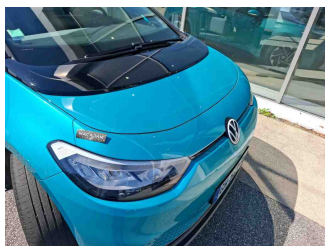

7 - Tyres - No damage - Acceptable

