


» Overview

Order number: 1001970507
Order completed: 26.06.2025 14:57
Report number: 8586497
VIN: WAUZZZF10ND018383



Front Left 3/4

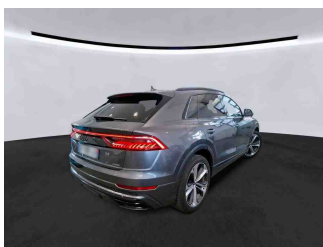

Rear Right 3/4



Mileage

» Vehicle Data

Vehicle category:	Passenger Car
Vehicle type:	SUV
Make:	Audi
Model:	Q8
Manufacturers and type code:	0588 / BXJ
Date of first registration:	29.03.2022
Mileage:	109,617 km
Proof of mileage:	
Exterior colour:	Noir-Noir-Gris Roche/Noir-Noir/Noir/Noir
Roof colour:	Gris Daytona Nacré
Propulsion:	4 Wheel-drive
Fuel:	Hybrid Petrol
Engine size (cc):	2,995 ccm
Performance:	250 kW (340 PS)
Length:	4,986 mm
Height:	1,705 mm
Width:	1,995 mm
Permitted total weight:	3,055 kg
Wheelbase:	2,995 mm
Number of powered axles:	2
Cylinders:	6
Euronorm:	
Number of doors:	5
Number of seats:	5
Gearbox:	Automatic 8-speed
Upholstery type:	Lining leather
Interior colour:	Gris Daytona Nacré
Number of keys:	2

» Documents & Maintenance

Statutory inspection date:	
Registration certificate available:	Yes
Registration certificate received:	Yes
License plate:	None
Maintenance book:	Digital
Maintenance:	Completed
Maintenance last date:	
Maintenance last mileage:	

3-zone deluxe automatic air conditioning	Convenience key with sensor-controlled release of the luggage compartment lid, without Safelock
4-way lumbar support for the front seats	Cruise control including speed limiter
6-cylinder SI engine 3.0 l unit 06M.C	Cruise control with speed limiter
6-cylinder SI engine 3.0 l/250 kW hybrid electric vehicle, TFSI, 280 kW system output; base engine is T9I	Data module, Europe
Acoustic vehicle alerting system	Digital audio broadcasting
adaptive air suspension sport	Disk brakes, front, 19-inch (ECE)
Adhesive film	Disk brakes, rear, 18-inch (ECE)
Ambient lighting package plus	Domestic connector type E/F, 8A, straight, for the e-tron charging system
Assist package Park with park assist plus	Door sill trims with aluminum inlays, front and rear, illuminated, front with S logo
Audi AG	Driver and front passenger airbag with front passenger airbag deactivation
Audi connect emergency call & service with Audi connect remote & control	Driving on the right
Audi connect key	Electric luggage compartment cover
Audi connect navigation & infotainment	Electric motor (hybrid electric vehicle), total system output 280 kW, unit 0EE.A
Audi connect stolen vehicle tracking system	Electromechanical power steering
Audi drive select	Electronic immobilizer
Audi music interface	Emblems
Audi pre sense basic	Emission standard EU6 AP
Audi pre sense front	Entry LED with projection, front and rear
Audi sound system	Equipment options subset for France
Audi Sport wheels, 5-twin-spoke module, Matt Structured Gray inserts, 10.0J x 22, 285/40 R22 tires	Equipment package for France I
Audi Sport/quattro GmbH wheels	Exterior mirror housings in body color
Audi virtual cockpit	Exterior mirrors, power-adjustable, heated and folding, auto-dimming on both sides, with memory feature
Auto-dimming interior rearview mirror, frameless	First-aid kit with warning triangle
Automatic slip-control differential	Floor mats in front and rear
Auxiliary air conditioning	Front head restraints
Basic equipment	Front license plate carrier
Battery 520 A (92 Ah)	Front seats, electrically adjustable including memory function for both front seats
Black roof rails	Front seats, electrically adjustable with memory function
Black Styling package	Fuel system for SI engine with direct injection (FSI)
Bluetooth interface	Fuel tank
Body style variant 1	Gloss package, black
Bumpers, S line, in full paint finish	HD Matrix LED headlamps with dynamic light design and dynamic turn signal
Camera-based traffic sign recognition	Headlight cleaning system
Carrier frequency 433.92 MHz-434.42 Mhz	Headlining in cloth, Black
Charging cable mode 3, type 2 3 32 A	Hold assist
Charging socket AC type 2	Hybrid propulsion system PHEV
Comfort center armrest, front	Increase in initial standard fuel filling
Control buttons in Gloss Black with haptic feedback and aluminum-look interior	Inlays, Matt Brushed Aluminum
Control of series production	Insert for the filling up of unleaded fuel
Control of special edition prices	

Installation parts for six-cylinder engine	Right exterior mirror, aspherical
Instrument cluster, km/h speedometer	Roof edge spoiler including center high-mounted stop lamp
Internal control code	S line
ISOFIX child seat mounting and top tether for the rear seat bench	S line Exterior package
ISOFIX child seat mounting for the front passenger seat	S line logo, exterior
Labels in English and French	S line Sport package
Lane departure warning	Safety steering column
LED headlamps	Seat heaters in front
LED rear lights with dynamic light sequencing and dynamic turn signal	Separate daytime running light
Left exterior mirror, aspherical	Service indicator 30 000 km or 2 years (variable)
Left-hand drive	SI engine
Loading sill protector, stainless steel	Side airbags, front and head airbag system
Long wheelbase	Singleframe mask in Matte Platinum Gray
Luggage compartment lid, electrically opening and closing	Smartphone interface
Luggage compartment mat	Special identification label (EU)
Manual in French	Sport contour leather steering wheel, 3-spoke, flat bottom with multifunction and shift paddles
Matrix LED headlamps and LED rear combination lamps	Sport seats plus, front
MMI navigation plus with MMI touch response	Stainless steel pedals and footrest
Model designation as per new engine power designation	Standard battery/alternator capacity
N.N.N. Type 1	Standard climatic zones
No self-collection	Standard electric
No special edition	Standard equipment
No special purpose vehicle, standard equipment	Standard exhaust system
Non-smoker version	Standard manufacturing sequence
Not hot country	Standard pedestrian protection
Operating permit, alteration	Standard-production quality
Park assist plus	Sun visor on driver and front passenger side
Park assist with parking system plus	Surround view cameras
Part set without country-specific prescriptive standard	tiptronic
Passenger car design	Tire mobility system
Passenger presence detection	Tire pressure monitoring system
Power latching for the doors	Tires 285/40 R22 110Y XL
Preparation for functions on demand	Tires without specification of tire brand
Privacy glass (dark-tinted windows)	Tool kit
quattro (with self-locking center differential)	Transit coating (type 1)
Rail system in the luggage compartment	Two-tone horn
Rear and side windows with heat-insulating glazing	Type approval country France
Rear seat bench plus	Upper interior elements in leather
Rear trim panel (ECE)	Valcona leather with S embossing and rhombus pattern
Recuperation	Vehicle charging cable
Refrigerant R1234yf	Vehicle class differentiation -4MF-
Regional code " ECE " for radio	Vehicles without special upgrade measures
	Weight category front axle weight range 12

Weight range 12 installation control only, no requirement forecast

Wheel bolts with anti-theft protection and loose wheel detection

Windshield wiper arms and blades, standard

Windshield with heat-reflecting glass

With multifunction camera

With special labels safety certificates for France

Without "Multimedia" in vehicle

Without action

Without active roll stabilization

Without AdBlue tank

Without additional front underbody guard

Without additional seals outside

Without additional tires

Without Air Quality package

Without all-wheel steering

Without alternator

Without antenna amplifier

Without auxiliary heater/parking heater

Without CD changer/CD player

Without combined lateral and longitudinal control

Without fire extinguisher

Without front cross traffic assist

Without front spoiler

Without garage door opener

Without head-up display

Without heat accumulator/auxiliary heater

Without ignition/starter switch locking system, without steering lock

Without integrated toll system

Without lane change assist

Without mains cable for industrial connector for the e-tron charging system

Without night vision

Without partition

Without roll-up sunshade

Without roof insert (standard roof)

Without seat ventilation/massage seat

Without special body measures

Without step

Without trailer hitch

Without wall bracket

» Tyres

MOUNTED TYRES

Make	Location	Position	Type	Rim	Dimensions	Profile depth
Goodyear	Front	Left	Summer	Aluminium	285/40 R 22 110 Y	6.0 mm
Goodyear	Front	Right	Summer	Aluminium	285/40 R 22 110 Y	5.3 mm
Goodyear	Rear	Left	Summer	Aluminium	285/40 R 22 110 Y	6.6 mm
Goodyear	Rear	Right	Summer	Aluminium	285/40 R 22 110 Y	6.5 mm

Permitted: Yes

Roadworthy: Yes

SPARE/EMERGENCY TYRE & ACCESSORIES

Repair kit present: Yes

Repair kit expiration date: 12.2026

Compressor present: Yes

» Devaluation Factors

Nr	Location	Damage type	Repair type
1	Boot lid covering R	Scratch(es)	Replace
2	Tyre FL	Tear	Replace
3	Tyre RL	Tear	Replace
4	Tyre FR	Tear	Replace
5	Door FR	Scratch(es)	Paint
6	Preparationtime plastic painting	Paint preparation	Execute
7	Sill trim L	Scratch(es)	Paint
8	Bumper spoiler Rear	Scratch(es)	Repair and paint (complete)
9	Door RL	Scratch(es)	Spot repair
10	Door FL	Scratch(es)	Spot repair
11	Floor mat F	Tear	Smart repair
12	Alloy rim FL	Scratch(es)	Repair and paint (partial)
13	Alloy rim RL	Scratch(es)	Repair and paint (partial)
14	Alloy rim RR	Scratch(es)	Repair and paint (partial)
15	Alloy rim FR	Scratch(es)	Repair and paint (partial)
16	Bumper moulding F	Scratch(es)	Paint
17	Bumper moulding F	Scratch(es)	Paint
18	Bumper moulding R	Scratch(es)	Paint
19	Door trim RL	Unclapsed	Dismount/Mount

» Usage Damages

Nr	Location	Damage type	Repair type
1	Door RR	Scratch(es)	Acceptable
2	Bumper FR	Scratch(es)	Acceptable
3	Wing RL	Scratch(es)	Acceptable
4	Tyres	No damage	Acceptable
5	Bumper moulding R	Scratch(es)	Acceptable
6	Bumper moulding R	Scratch(es)	Acceptable
7	Bumper R	Deformed / Strained	Acceptable
8	Sill trim R	Scratch(es)	Acceptable
9	Wing trim RR	Scratch(es)	Acceptable

» Commercial devaluation

Known previous damages:	No
Previous damages detectable:	No
Repainting present:	No
Paint thickness measurement performed:	No

» Notes On The Assessment

Details of the assignment and the scope of the assessment:

The order was placed to prepare a condition report on the described vehicle.

The vehicle condition assessment was carried out in accordance with the order on the basis of the standards for vehicle assessments specified by the client. The expert makes the findings in the individual case on the basis of his own expertise and at his own expert discretion.

Vehicle identification:

WAUZZZF10ND018383

VIN checked and matches documentation

Vehicle condition:

Cleaned

Inspection condition:

Sufficient

Colour matching:

The vehicle color no longer corresponds to the delivery condition.

Lifting platform/lifting equipment used:

No

Testdrive carried out:

Yes

Engine test carried out:

Yes

» Remarks

This copy was generated electronically. It is valid without an original signature.

» Commercial Pictures



Front Left 3/4



Front Right 3/4




Rear Left 3/4




Rear Right 3/4



Mileage

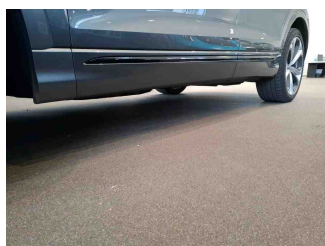


Sill outer L

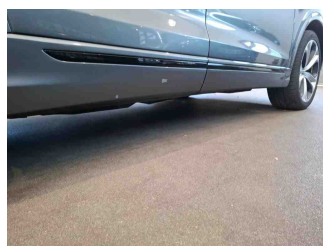


Sill outer R




Chassis nr

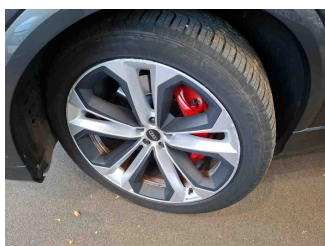


Wheel FL

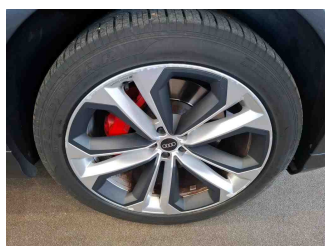


Wheel FR

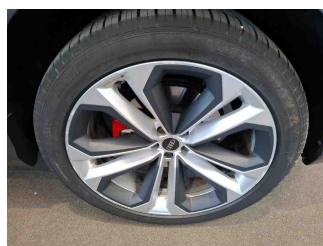

Wheel RL

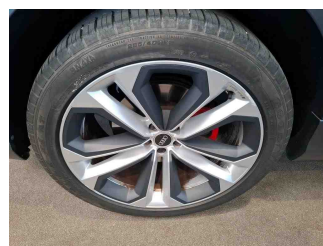


Wheel RR

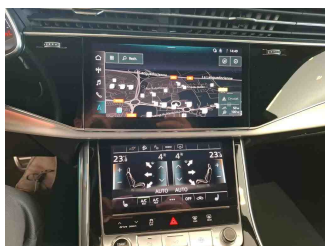

Central console




Engine compartment

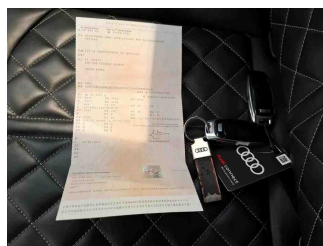


Documents



Interior arrangement

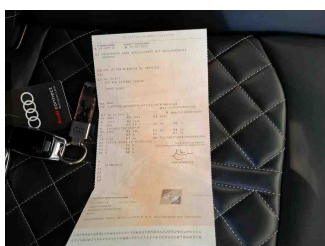


Registration Certificate

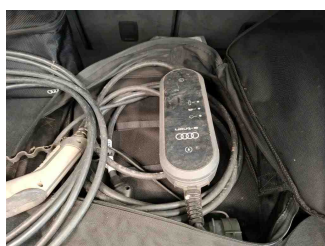


Charging cable (normal)




Rearview camera

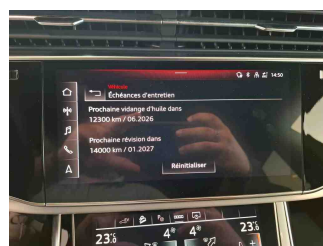

History Maintenance

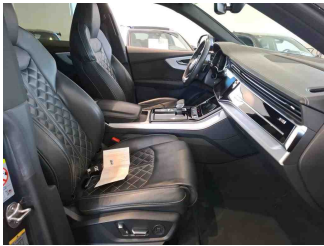


Interior - front

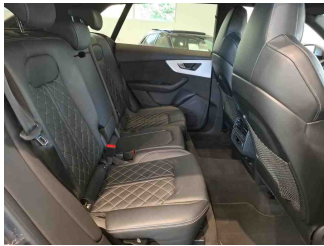

Interior - rear



Tirefit expiration date

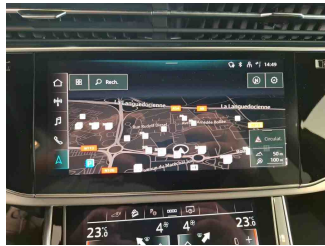

GPS/Radio



» Devaluation Damages

DEVALUATION FACTORS



1 - Boot lid covering R - Scratch(es) - Replace




2 - Tyre FL - Tear - Replace

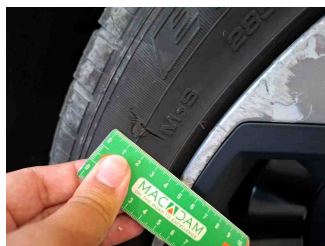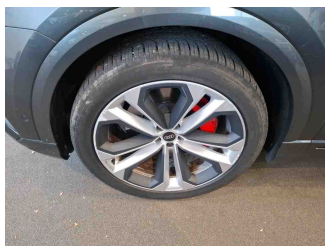


3 - Tyre RL - Tear - Replace

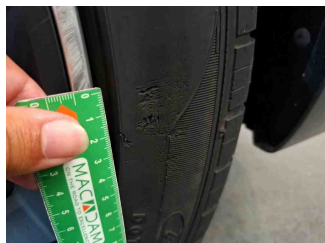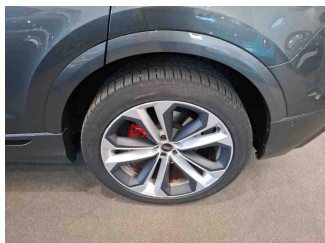

4 - Tyre FR - Tear - Replace

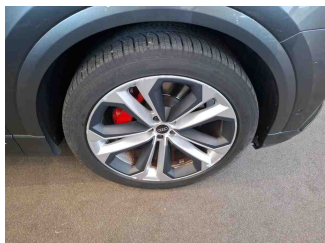


5 - Door FR - Scratch(es) - Paint

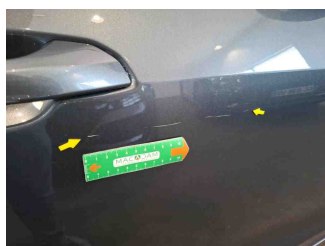




6 - Preparationtime plastic painting - Paint preparation - Execute





7 - Sill trim L - Scratch(es) - Paint

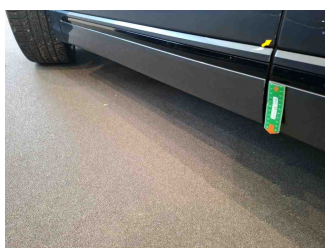


8 - Bumper spoiler Rear - Scratch(es) - Repair and paint (complete)

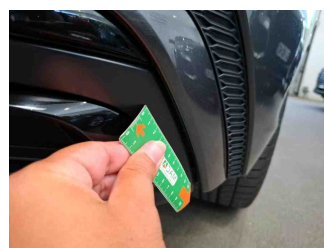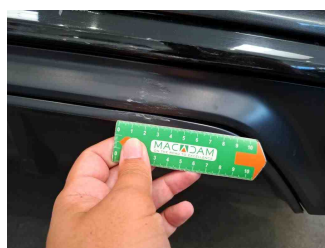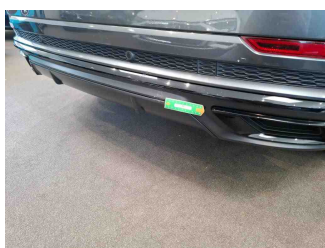


9 - Door RL - Scratch(es) - Spot repair

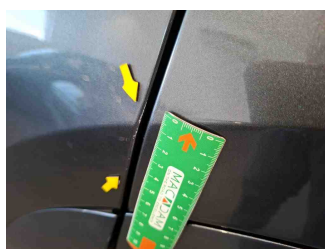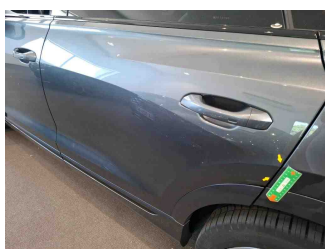





10 - Door FL - Scratch(es) - Spot repair

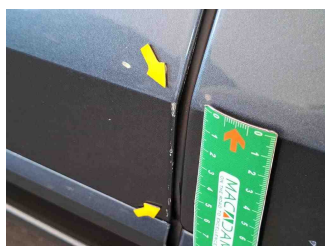



11 - Floor mat F - Tear - Smart repair

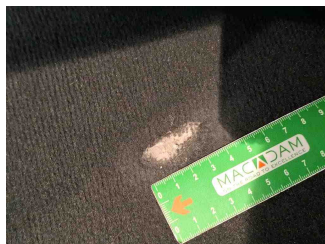




12 - Alloy rim FL - Scratch(es) - Repair and paint (partial)

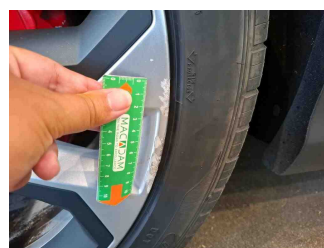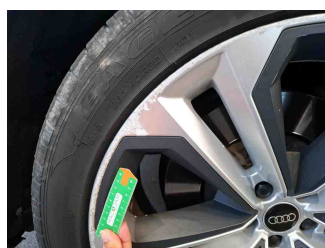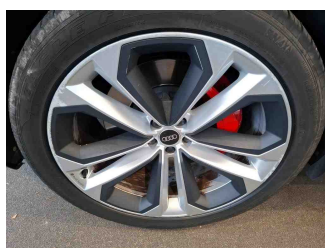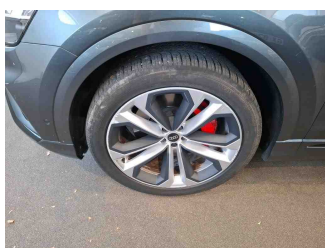




13 - Alloy rim RL - Scratch(es) - Repair and paint (partial)

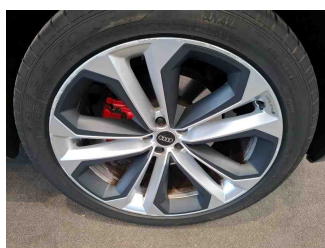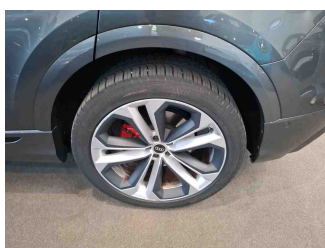



14 - Alloy rim RR - Scratch(es) - Repair and paint (partial)

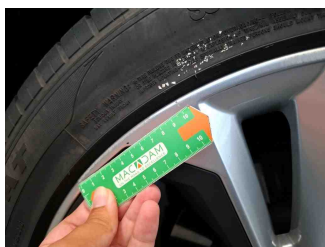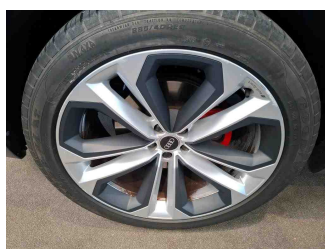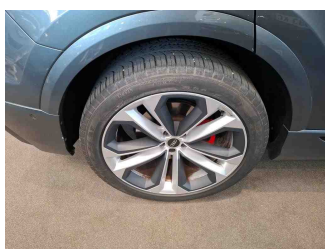

15 - Alloy rim FR - Scratch(es) - Repair and paint (partial)

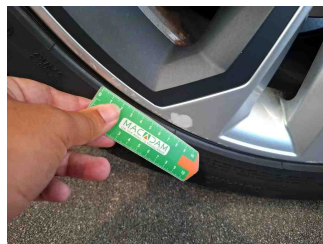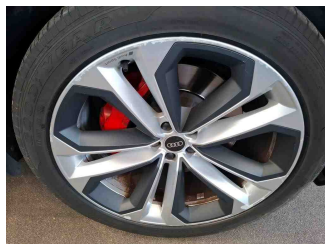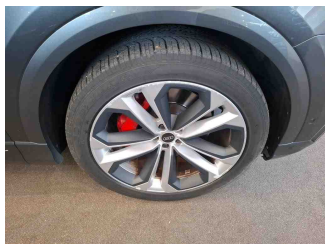




16 - Bumper moulding F - Scratch(es) - Paint

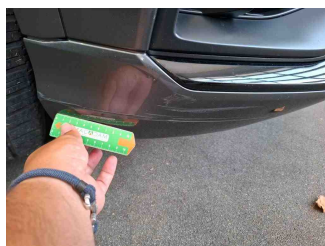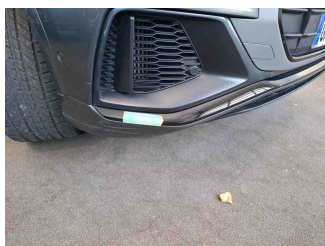



17 - Bumper moulding F - Scratch(es) - Paint



18 - Bumper moulding R - Scratch(es) - Paint

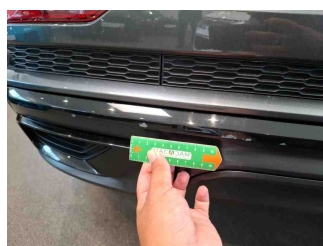
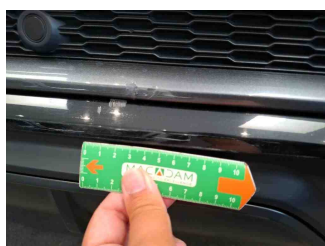
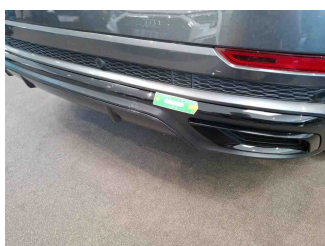


19 - Door trim RL - Unclashed - Dismount/Mount

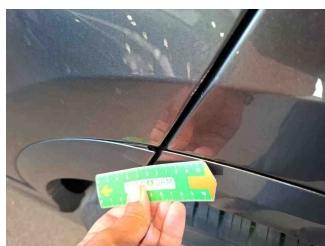
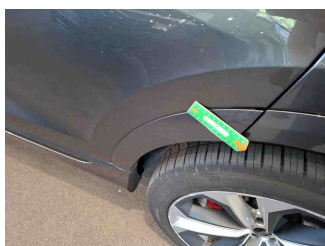


USAGE DAMAGES



1 - Door RR - Scratch(es) - Acceptable

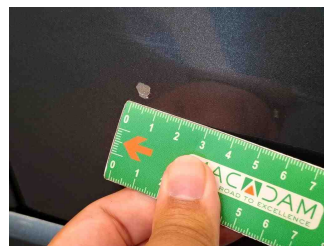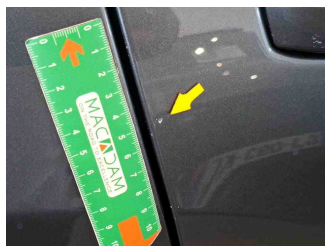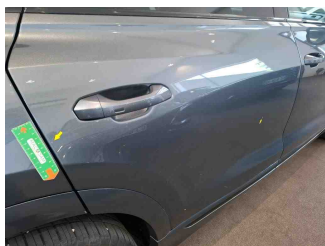






2 - Bumper FR - Scratch(es) - Acceptable



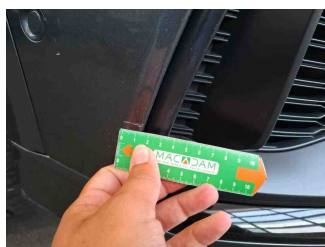
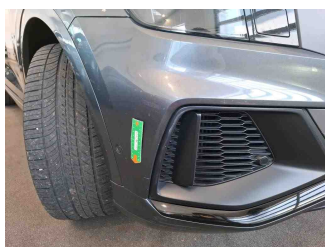






3 - Wing RL - Scratch(es) - Acceptable

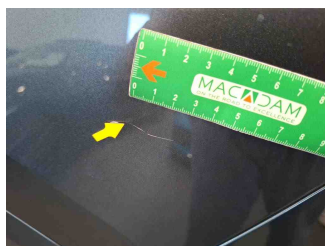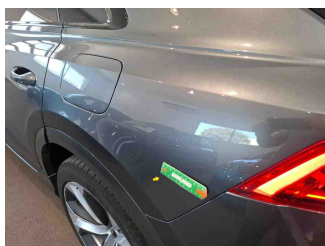

4 - Tyres - No damage - Acceptable

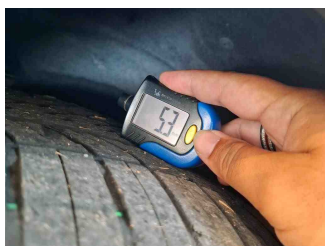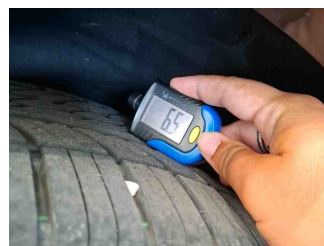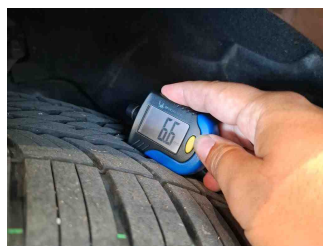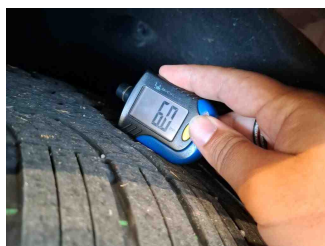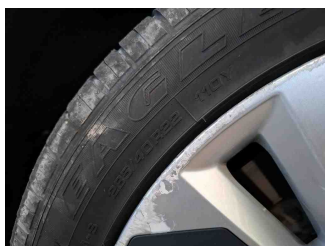

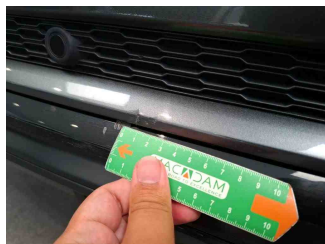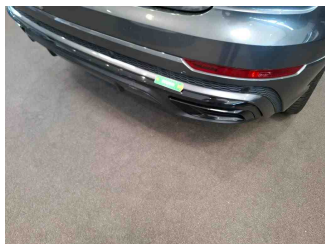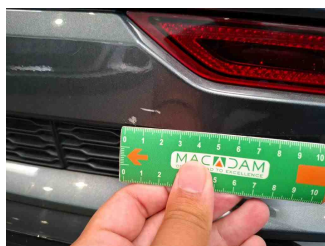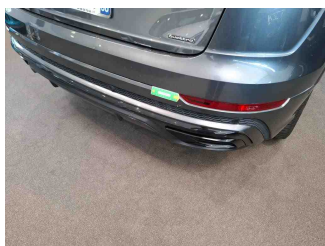5 - Bumper moulding R - Scratch(es) - Acceptable

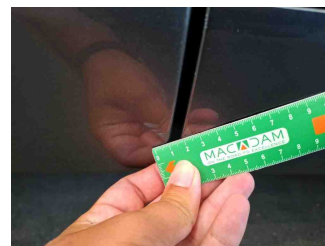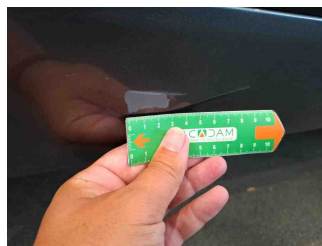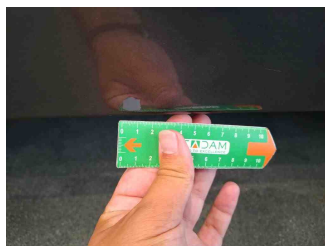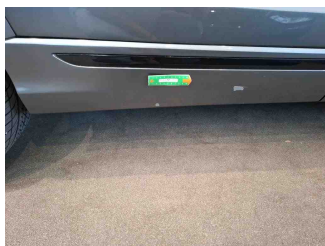6 - Bumper moulding R - Scratch(es) - Acceptable

7 - Bumper R - Deformed / Strained - Acceptable

8 - Sill trim R - Scratch(es) - Acceptable

9 - Wing trim RR - Scratch(es) - Acceptable
